


Pinpoint Testing- VMS Connector (P2)

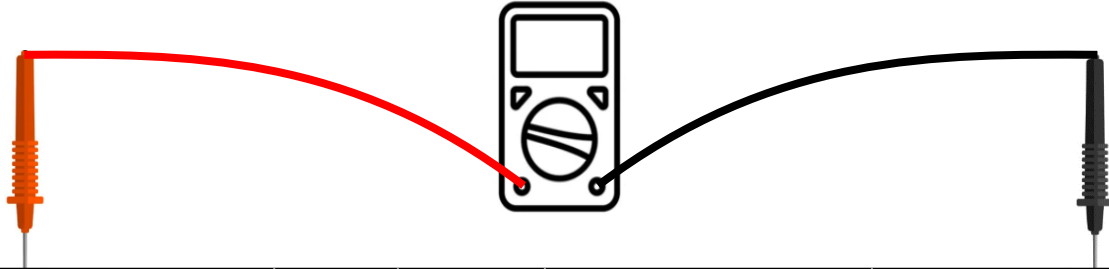

+							-	
Pin Number	Wire Colour	Description	Input/Output	Bike Mode	Test Conditions	Value (Approx)	Pin Number	Wire Colour
1	Blue	CAN L	Input/Output	ACC/RUN	-	5V 0V	7	Brown
2	Green	CAN H	Input/Output	ACC/RUN	-	5V 0V	7	Brown
3	Orange	+12 VDC	Output	ACC/RUN	-		7	Brown
4	Blue	RHF Indicator	Output	RUN	RH Indicator Activated	12V 0V	7	Brown
5	Blue	LHF Indicator	Output	RUN	LH Indicator Activated	12V 0V	6	Black
6	Black	0 VDC	GND	-	-	-	-	-
7	Brown	0 VDC	GND	-	-	-	-	-
8								
9								
10	Black	0 VDC	GND	-	-	-	-	-
11	Blue	Kick Stand Switch Signal	Input	ACC/RUN	Kick Stand Raised	3.3V	10	Black
					Kick Stand Lowered	0V		
12	Red	+3.3 VDC	Output	ACC/RUN	-	3.3V	10	Black